




CONSTRUCTION CONSULTING LABORATORY, *INTERNATIONAL*

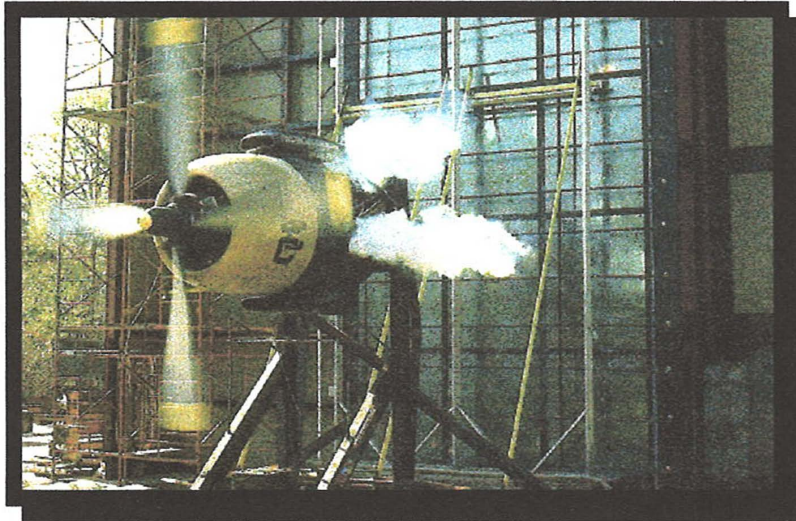

TEST REPORT:

**FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002**

January 7, 2004

Prepared for:

BIRDVIEW SKYLIGHTS
201 Longhorn Road
Ft. Worth, TX 76179

1601 Luna Road
Carrollton, Texas 75006

S-UNITED, INC.
A Quality Control Company

Office: (972) 242-0556
FAX: (972) 245-6047



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004

TABLE OF CONTENTS

1. PROJECT DATA	1
2. INTRODUCTION	2
3. SCOPE	2
4. SUMMARY	2
5. TEST SPECIMEN	2
6. PERFORMANCE RESULTS	3
7. CONCLUSION	4

APPENDIXES

- APPENDIX A: BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT DRAWINGS
- APPENDIX B: PHOTOGRAPHS
- APPENDIX C: DIGITAL VIDEO CD



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004
Page 1 of 4

1. PROJECT DATA

<u>Project:</u>	Fall Protection Test Birdview Skylights Series FS-CM Skylight
<u>Date of Testing:</u>	January 6, 2004
<u>Tested For:</u>	Birdview Skylights 201 Longhorn Road Ft. Worth, TX 76179

Witnessed By: (All or Partial Viewing)

Juvenal Azua
John Perry
Wesley Wilson

Construction Consulting Laboratory, *International*
Construction Consulting Laboratory, *International*
Construction Consulting Laboratory, *International*



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004
Page 2 of 4

2. INTRODUCTION

This report presents the results of Fall Impact Tests conducted on January 6, 2004 at Construction Consulting Laboratory, *International* (CCLI). Testing was conducted for Birdview Skylights on their Series FS-CM Skylight.

3. SCOPE

CCLI was requested to perform fall impact tests on a Birdview Skylights Series FS-CM Skylight. Testing was performed in accordance with manufacturers requirement as follows, 200 lb load dropped into mid-span of dome will cause no glazing disengagement or breakage of glazing material at a minimal force of 775 ft/lbs. Further, the 200 lb load will be dropped from incremental heights until failure is achieved.

4. SUMMARY

Birdview Skylights Series FS-CM complied with manufactured specified concentrated load fall impact test with no glazing breakage or disengagement from frame members with a minimal impact force of 775 ft/lbs. At an impact force of 1000 ft/lbs the aluminum-retaining angle corner weld began to tear on the retaining angle. However, glazing material was not damaged and no disengagement from frame glazing leg was noted. Testing was discontinued after the 1000 ft/lb impact load.

5. TEST SPECIMEN

PRODUCT TYPE: Aluminum Skylight, **Photograph 1, Appendix B, Product Drawings Appendix A**
SERIES/MODEL: Birdview Skylights Series Fall Protection Skylight
FRAME SIZE: 6'-0" x 8'-0"
CONFIGURATION: O

Refer to Mock-Up drawings in **Appendix A**, this report is not complete unless the laboratory symbol is stamped onto drawings.

 **CONSTRUCTION CONSULTING
LABORATORY, INTERNATIONAL**
1601 Luna Road
Carrollton, Texas 75006
Phone (972) 242-0556



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004
Page 3 of 4

Weather-stripping: Continuous 101.64 santoprene rubber gasket at the center leg of curb frame, full perimeter.

Hardware: None

Glazing Material: Inner dome constructed from 0.100" thickness polycarbonate (GE Lexan 9034) and outer dome constructed from 0.118" polycarbonate (GE Lexan XL10).

Glazing: Domes are exterior glazed, inner dome sealed to rubber gasket at center leg of curb frame with silicone sealant applied at exterior face of inner dome retaining flange, between inner and outer domes full perimeter. Silicone sealant is applied to the exterior face of outer dome full perimeter and aluminum retaining angle secured to domes with #10 x 1" HWHSD and neoprene washers spaced 4" from each end and on 10" centers. Domes and retaining angles fastened to curb frame with #10 x $\frac{3}{8}$ " stainless steel HWHSMS screws spaced 4" from each end and on 10" centers. Curb frame applied to nominal 2" x 8" wood curb with #14 x 1" lag screws spaced 4" from each end and on 10" centers, **Fastener Layout Detail, Appendix A.**

Installation: Skylight frame was installed to a 2" x 8" curb with #14" x 1" lag screws, approximately 4" from each end and on 10" centers.

Other Features: Aluminum retaining angle and frame member corners are mitered and welded.

Date testing started: January 6, 2004

Date testing completed: January 6, 2004

Testing performed at: Construction Consulting Laboratory, *International*

6. PERFORMANCE RESULTS

6.1. FALL IMPACT LOAD TEST

Load	Drop Height	FT/LBS	Measured	Photograph
200 lbs	Dead Load		No Damage	2
200 lbs	2 Feet	400	No Damage	Digital Video
200 lbs	3 Feet	600	No Damage	Digital Video
200 lbs	3.875 Feet	775	No damage	Digital Video
200 lbs	4 Feet	800	No Damage	Digital Video
200 lbs	5 Feet	1000	Corner weld tear	3



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004
Page 4 of 4

6.2. At the conclusion of the 1000 ft/lbs fall test, it was noted that the aluminum retaining angle corner weld tore during impact, **Photograph 3, Appendix B.**


Detailed extrusion and assembly drawings indicating measured wall thickness and corner construction are on file and were compared to the test sample submitted. These records will be retained at **CCLI** for a period of four years.

7. CONCLUSION

The test specimen met the manufacturer minimum impact force of 775 ft/lbs test requirements for fall protection. At the completion of the 1000 ft/lbs fall test it was noted the aluminum retaining angle tore during impact, however there was no glazing breakage or disengagement from the aluminum frame. Testing was discontinued at the 1000 ft/lb impact load.

Respectfully submitted,

CONSTRUCTION CONSULTING LABORATORY, *INTERNATIONAL*


WESLEY A. WILSON
LABORATORY MANAGER


JOHN PERRY
TEST TECHNICIAN



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004

APPENDIXES



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004

APPENDIX A

PROJECT DRAWINGS

Drawing No.

Date

Series FS-CM skylight Lay-Out Detail
Curb Mount Detail
Top Angle

06/28/99
11/13/96
12/09/92

BIRDVIEW SKYLIGHTS

THE CLEAR CHOICE

201 LONGHORN RD. FT. WORTH TX. 76179
Ph. 817-439-9266 Fx. 817-232-8468

DRAWING# FALLSTOP CM SHEET 1 OF 1

DRAWN BY: E. BIRD

DATE: 6 - 28 - 99 SCALE: FULL and NOTED

LARGE MISSILE IMPACT RESISTANT

DESIGN PRESSURES


Positive +52.5 Negative -56.1

GENERAL NOTES

1. 4" CLEAR MINIMUM REQUIREMENT FOR SHINGLE & BUR WITHOUT INSULATION FOR INSULATION AND TILES ADD THE INSULATION THICKNESS AND THE TILE HEIGHT TO 4".
2. WEEP HOLES ARE NOT REQUIRED
3. THE CURB (BY OTHERS) SHALL BE PROPERLY DESIGNED AND ANCHORED TO THE STRUCTURE AND / ON TRUSSES

CC CONSTRUCTION CONSULTING
LABORATORY, INTERNATIONAL

1601 Luna Road
Carrollton, Texas 75006
Phone (972) 242-0556

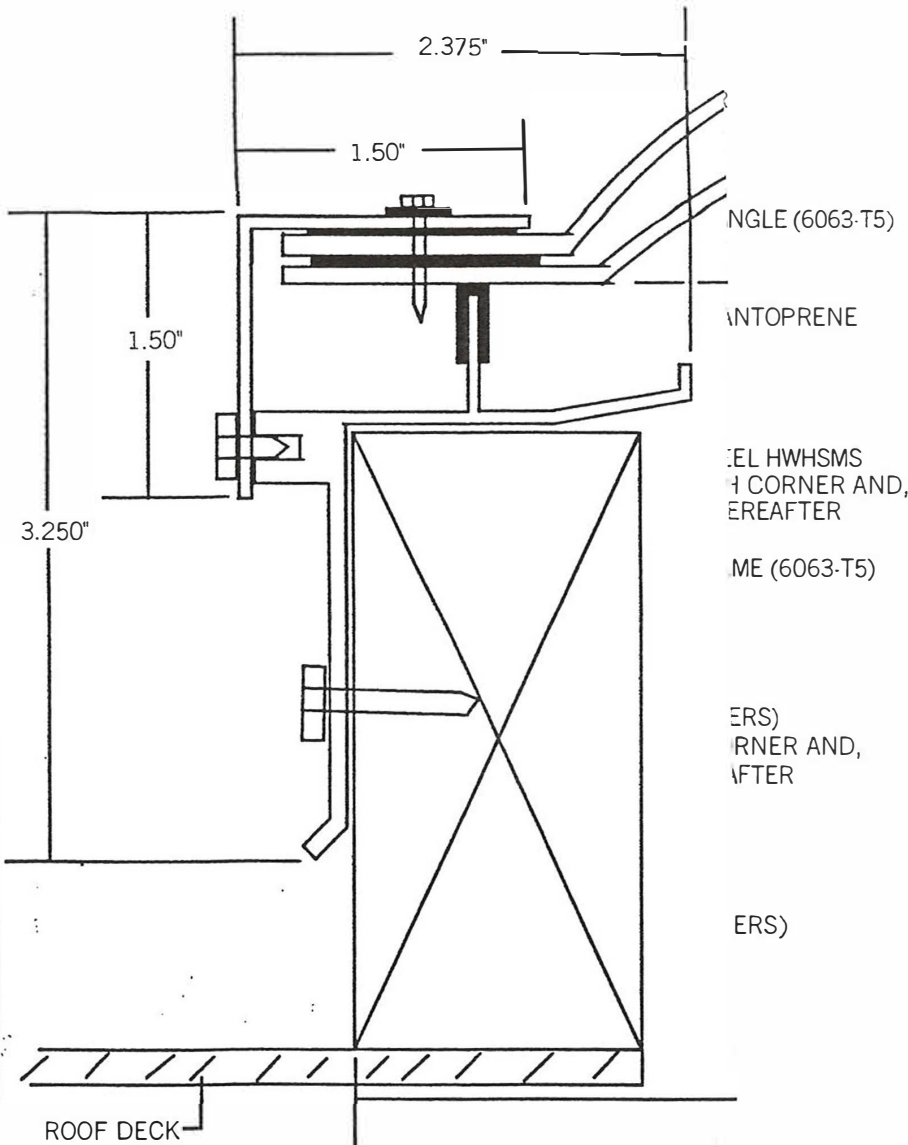

DATE:

ARCH:

PROJ:

LOC:


G.C.:

DIST:

Spaces at 10" O.C. Max


p) Each direction
ch corner

I.B.30



REVISION _____ _____ _____ _____				<i>tel</i> TOWER EXTRUSIONS, LTD.			
				NAME			
				BIRDVIEW SKYLIGHTS			
ALUMINUM ASSOCIATION STANDARD TOLERANCES TO APPLY UNLESS OTHERWISE SPECIFIED				PART NO.		DWG. NO.	
EST. AREA .399		CIRCLE SIZE 3-4	DATE: 11-13-96	DRAWN BY: D. LOUGH			
EST. WT/FT. .479			DIE SIZE 8X1	END USE CURB MOUNT ~ 2 1/4"			
EST. PERIM 11.449		FACTOR 24	HOLES 1	CLASS SOLID		ALLOY 6063	DIE NO. BVS-11363
		SCALE FULL					

DIE NO.	BVS-8554
BKR. NO.	3.A.38
BOLS. NO.	3.B.3

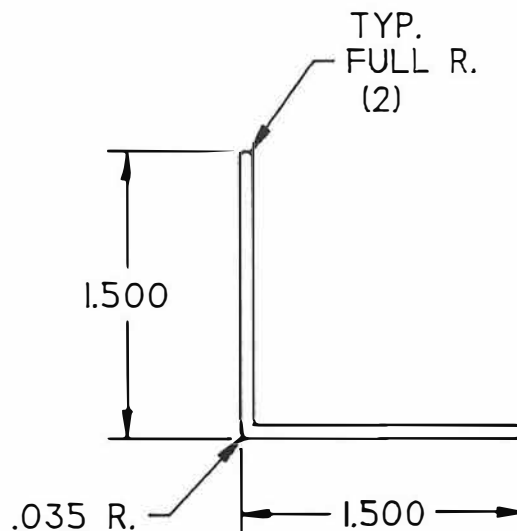


**CONSTRUCTION CONSULTING
LABORATORY, INTERNATIONAL**
 1601 Luna Road
 Carrollton, Texas 75006
 Phone (972) 242-0556

NOTES:

1. .070 TYP. WALL THK. EXCEPT AS NOTED.
2. BREAK SHARP CORNERS AT .015 R.

REVISION					tel TOWER EXTRUSIONS, LTD.					
					NAME					
					BIRDVIEW SKYLIGHTS					
	ALUMINUM ASSOCIATION STANDARD TOLERANCES TO APPLY UNLESS OTHERWISE SPECIFIED				PART NO.		DWG. NO.			
EST. AREA	.204	CIRCLE SIZE	2-3	DATE	12-9-92	DRAWN BY:	D.LOUGH	END USE	TOP ANGLE	
EST. WT./FT.	.245	FACTOR	24	DIE SIZE	8X1	CLASS	SOLID	ALLOY	6063-T5	DIE NO.
EST. PERM.	5.925	HOLES	3	SCALE	FULL					BVS-8554



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004

APPENDIX B

PHOTOGRAPHS



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004



PHOTOGRAPH 1

PRODUCT TYPE: Aluminum Skylight
SERIES/MODEL: Birdview Skylights Series FS-CM
FRAME SIZE: 6'-0" x 8'-0"
CONFIGURATION: O



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004




PHOTOGRAPH 2

200 lb dead load applied to the center mid-span of the Birdview Series FS-CM skylight.



FALL PROTECTION TEST
BIRDVIEW SKYLIGHTS SERIES FS-CM SKYLIGHT
REPORT #CCLI-04-002

January 7, 2004

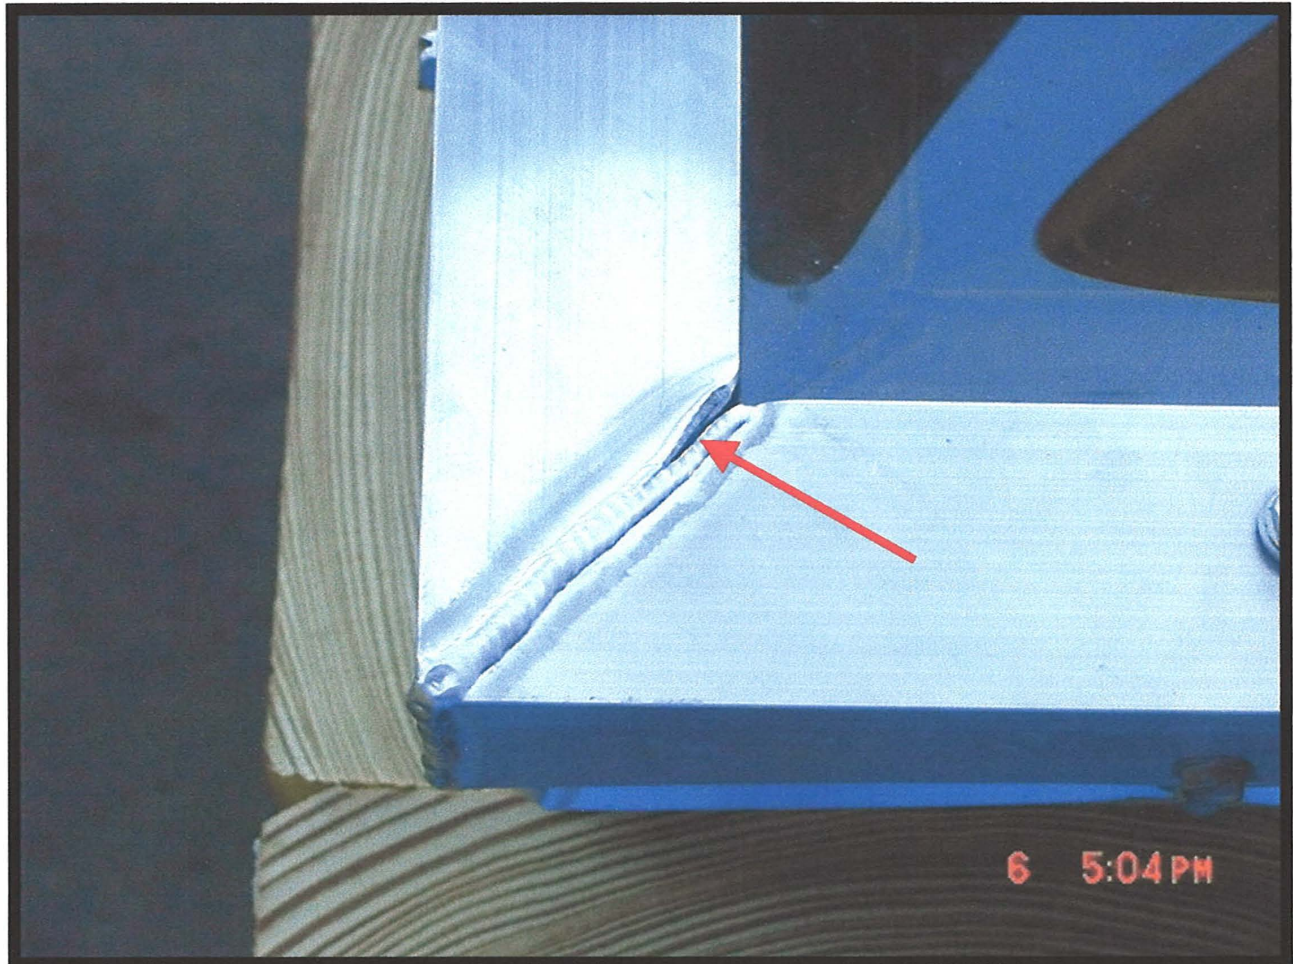

PHOTOGRAPH 3

Arrows indicate the tear in corner weld of the retaining angle at the conclusion of the 1000 ft/lbs fall test. No breakage or disengagement of glazing was noted.